

MONUMENT RECORD

Corner I.D. #

R-33



R-9

STATE OF INDIANA - COUNTY OF MONROE

Section Fourteen (14), Township 9 North, Range 1 East

Monument Description & Remarks: Stone found at NW corner of E 1/2 of
NW 1/4. Steel fence post placed next to stone. Corner witnessed 6/26/87.
(See attached notes)

Recovery Tie Drawing

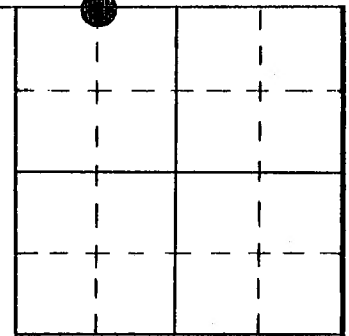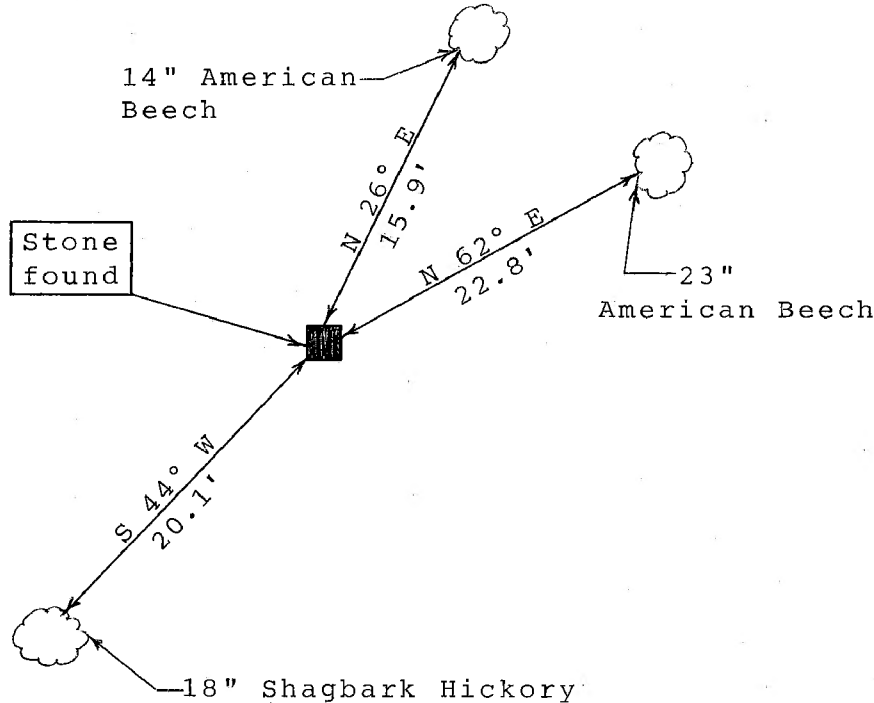

● At Corner



Not To Scale

State of Indiana
County of Monroe

I, Michael W. Friley, County Surveyor *M.W.F.*, hereby certify
that this document was prepared under my direction in
accordance with the provisions of Section 17-3-64-4
through 17-3-64-8 of the Indiana Code, being Acts of 1965,
Chapter 319; and the above data is given under my hand and
seal this 1st day of February, 1995 A.D.

Space
Reserved For
Recording
Officer

Indiana Registered Land Surveyor No. _____ or

Morgan-Monroe State Forest

United States Government Agency

Darrell Breedlove, Timber Specialist

Title

Field Book:

n/a

Page:

n/a

SECTION 14, T 9 N, R 1 E

rebar (see 3f)

1. On 6/26/87, the west line of the E $\frac{1}{2}$, NW $\frac{1}{4}$ was ran by compassing north from a pipe found at the SW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$. A stone was located at the NW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$ and it was witnessed as follows:

	<u>Az</u>	<u>Species</u>	<u>DBH</u>	<u>Distance</u>
54°-W	224	Shagbark Hickory	18"	20.1'
62°-E	062	Am. Beech	23"	22.8'
26°-E	026	Am. Beech	14"	15.9'

S 44°W
N 62°E
N 26°E

The bearing between the two markers is N 0.8E at 1°W declination. Plastic signs were posted at the stone.

Darrell Breedlove
Darrell Breedlove
Timber Specialist

2. On August 17, 1988, a steel fence post was driven next to the stone at NW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$, Sec. 14.

Darrell Breedlove
Darrell Breedlove

Timber Specialist

- 3a) On June 29, 1989, the South $\frac{1}{4}$ -mile stone of the SW $\frac{1}{4}$, Sec. 14, T9N, R1E was witnessed as follows:

PK nails were driven at the bases of these trees:

	<u>AZ</u>	<u>Spp.</u>	<u>DBH(in)</u>	<u>Distance(ft)</u>	<u>Comment</u>	
N-76°-E	076°	Sugar Maple	28	13.8	Hollow w/wire	3
S-07°-W	187	Basswood	19	20.8	w/wire	
S-33°-W	213	Sugar Maple	2	11.0		
N-63°-W	297	Red Elm	6	1.8	Dead tree in fence corner	

This stone has an "x" and measures 4"x8"x1"(h). It is S 0.9°E (1°W) from the SW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$, Sec. 14 (see 3b).

- b) On June 30, 1987, the SW corner, E $\frac{1}{2}$, NW $\frac{1}{4}$, Sec. 14 was witnessed as follows: PK nails were driven at the bases of the first three trees.

	<u>AZ</u>	<u>Spp.</u>	<u>DBH(in)</u>	<u>Distance(ft)</u>	<u>Comment</u>
S-22°-W	202°	White Oak	15	14.0	
S-34°-W	304	Red Oak	18	19.0	
N-05°-W	355	Red Maple	8	18.2	
N-61°-E	61	American Beech	2	11.8	Has yellow tag

this stone is laying on its side, but it has an "x".

- c) Two pipe markers were observed in the vicinity of the center of the SW $\frac{1}{4}$, Sec. 14, but neither marker is on-line between two stones found (see 3a and 3b). A $\frac{1}{2}$ "x10"